



Service Bulletin

SB 221 - January 2007

1 of 1

18513 Euclid Avenue

Cleveland, Ohio 44112-1084

www.meyerproducts.com

Phone: 216-486-1313 Fax: 216-486-9776

E-mail warranty@meyerproducts.com

SUBJECT: 17162 Ford F250/350 4WD Mounting Carton

To all concerned: Reference Form 1-873 the 17162 Installation Instructions.

Meyer Engineering has discovered a possible hole alignment issue when installing the 17162 on the Ford F250/F350 driver's side mount assembly P/N 19731 Mount Assembly (driver's side) onto the 2007 vehicle frame. Installation of the mount assembly requires additional holes to be drilled in the vehicle frame.

Reference Paragraph F on form 1-873 Installation Instructions.

While holding mount assembly tight to the bottom and side of the vehicle frame scribe hole locations to be drilled at "B" and "C" per illustration. FIGURE 1

Please take note when scribing hole "C" location. Depending on the individual vehicle frame tolerances, hole "C" in the P/N 19731 mount assembly maybe located too close to the steering gear mounting bolt. If this is the case, drill a new hole in the P/N 19731 mount assembly bracket per illustration FIGURE 2. Repeat steps in Paragraph F using the new hole in mount assembly. Continue to follow the installation instructions on form 1-873 until installation is complete.

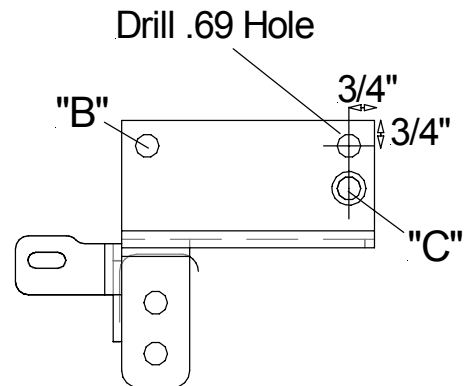
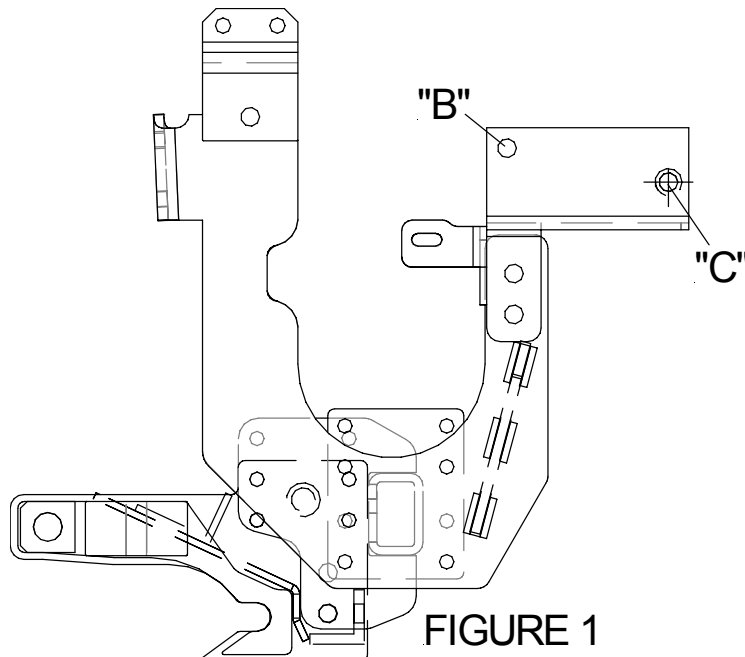


FIGURE 2

Meyer Products LLC assumes no responsibility for installations not made according to these instructions.

Initial	Route To:			
	President/Owner	Sales Manager	Service Manager	Parts Manager